






BASE MUST BE INITIALIZED BEFORE USE!

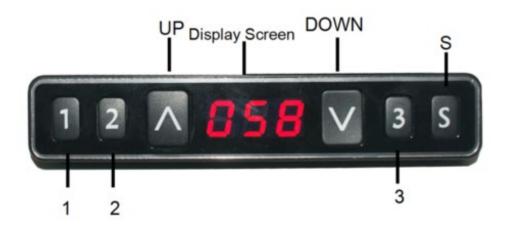

Step	Operation	Motion
1	Press and hold ∧&∨simultaneously for	Legs begin to move down at half speed of normal operation
	more than 3 seconds	
2	Keep pressing ∧&∨	Legs move down to the lowest position and rebound 2-5 mm, then stop
3	Release ∧&∨ together	Initialization is completed

OTHER FUNCTIONS

Up/down

Memory Positions

Lock Lowest Stroke...table will not go below this point

Lock Highest Stroke...table will not go above this point

Anti-Collision Sensitivity...safety feature can be adjusted to stop faster/slower